

**MD-MS (DM-2000)
Desk Top Microphone
Monitor Rework Instructions**

Modification Note

Date: June 8, 2009

Item: DM-2000 Desk top microphone

Issue: Monitor function error causes various consoles to lock MON into the down position.

Step 1

First determine which version DM-2000 you have by looking at the bottom plate.



Version 1 Adjustment internal




Version 2 Adjustment visible

Step 2

Remove rubber feet and screws from bottom of microphone. Gently separate top assembly from bottom assembly.


Step 3

Remove metal spring from both sides, pressing down on top part to clear switch paddle.

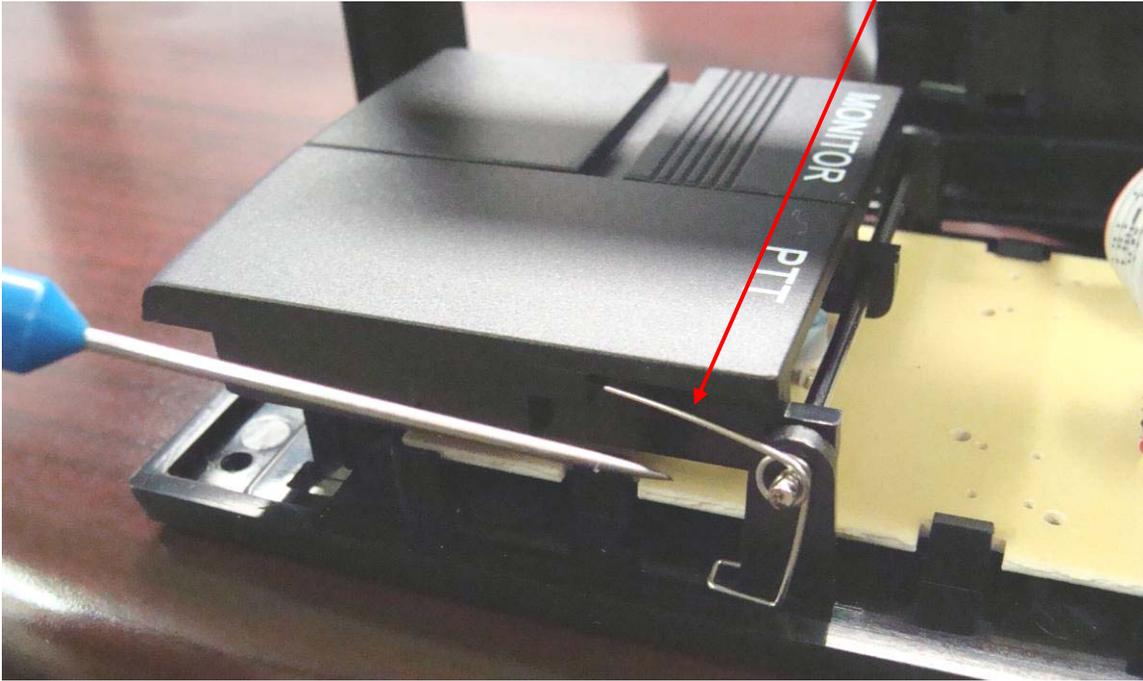

Step 4


Remove metal bar by sliding out sideways.

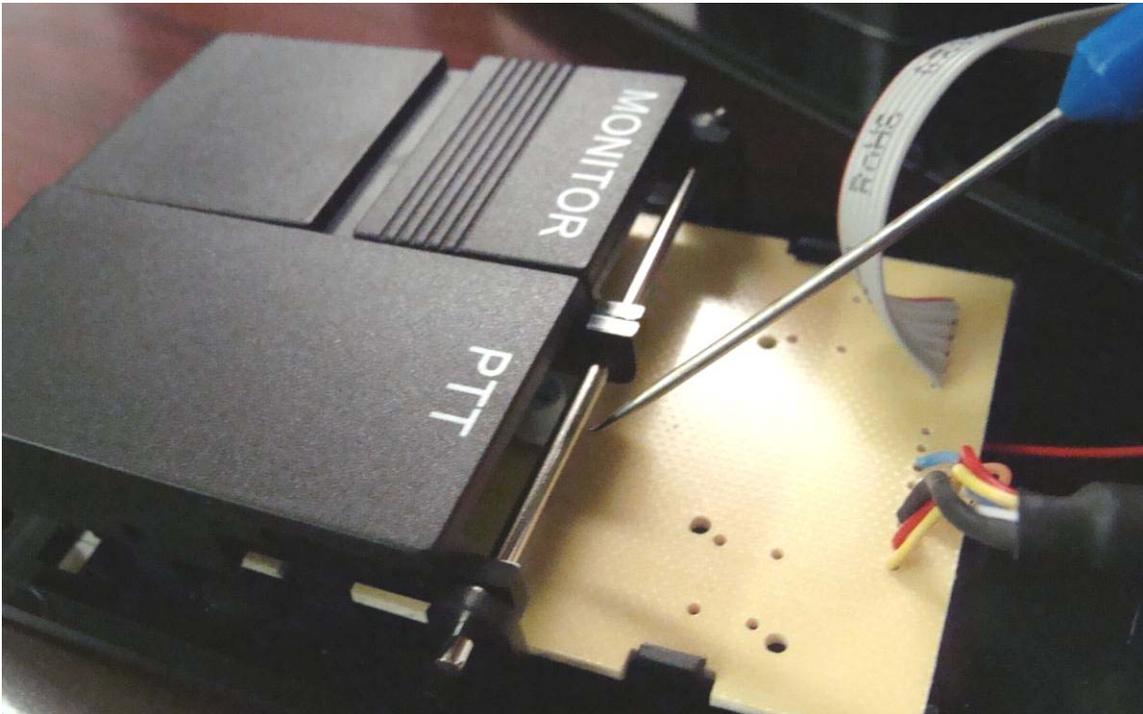

Remove switch paddles by pulling forward.

Step 5

Gentle press outward plastic tabs holding PCB assembly and remove PCB.

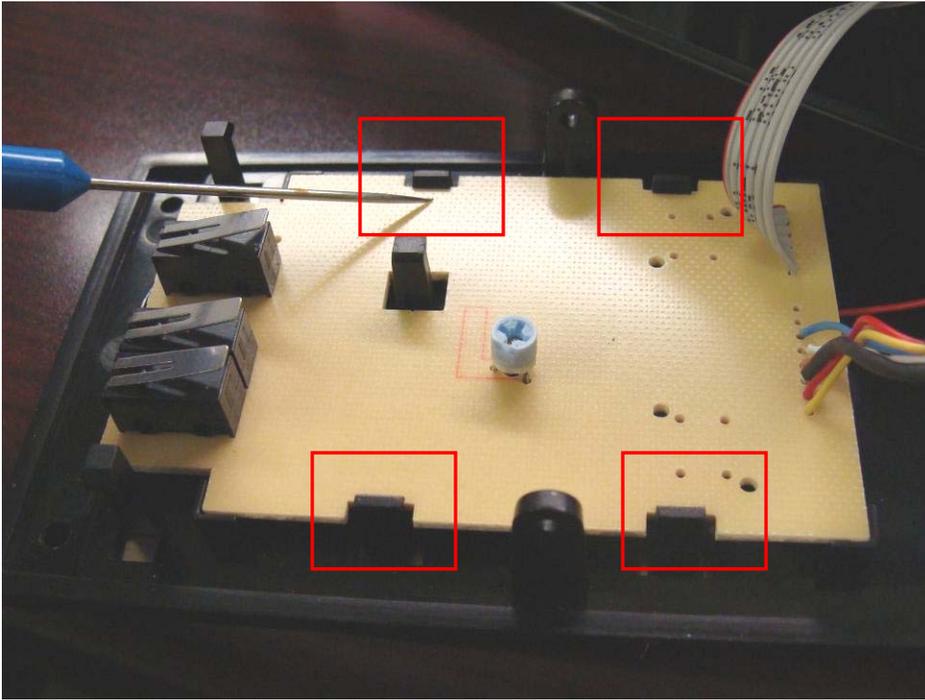


Step 6 Version 1 only.

Version 2 starts on page 5

On bottom of PCB complete the following:


Scratch/remove solder mask

Cut trace

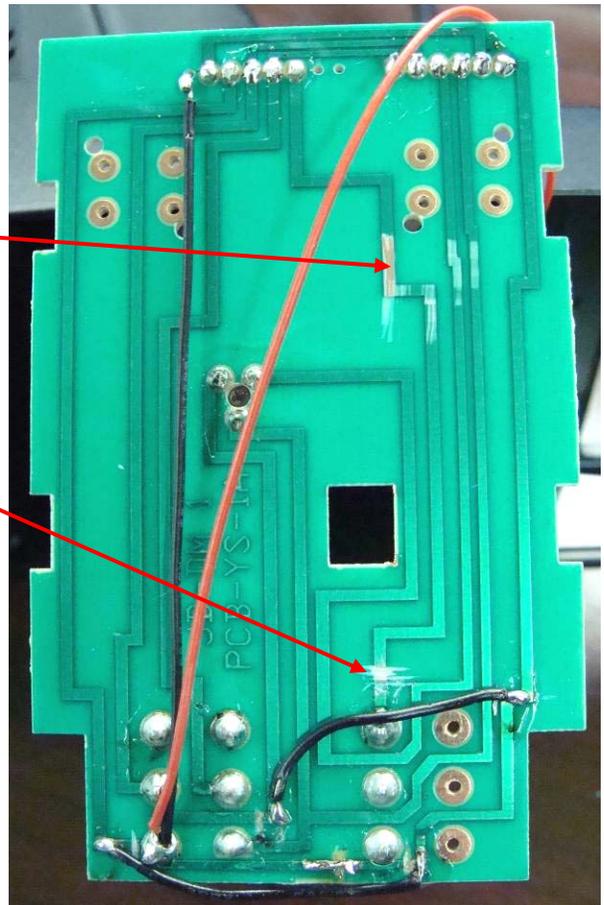

Step 7 Version 1

Add jumper wire between shown locations.

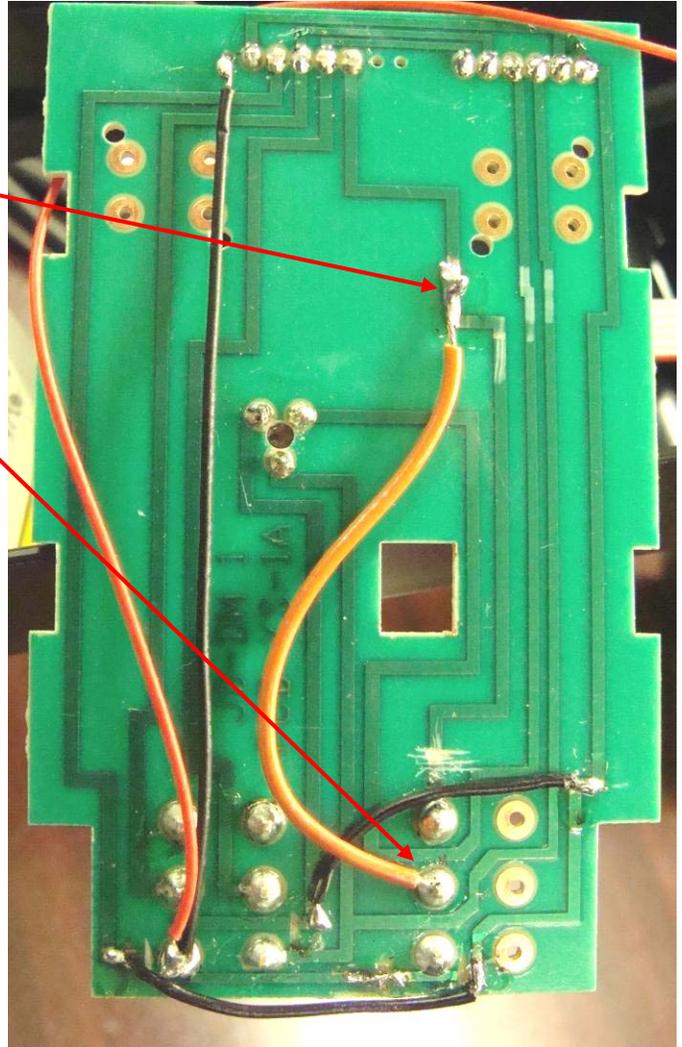


Step 8

Reassemble unit working backwards from step 5.

Step 6 Version 2 only.


On bottom of PCB complete the following:

Cut trace

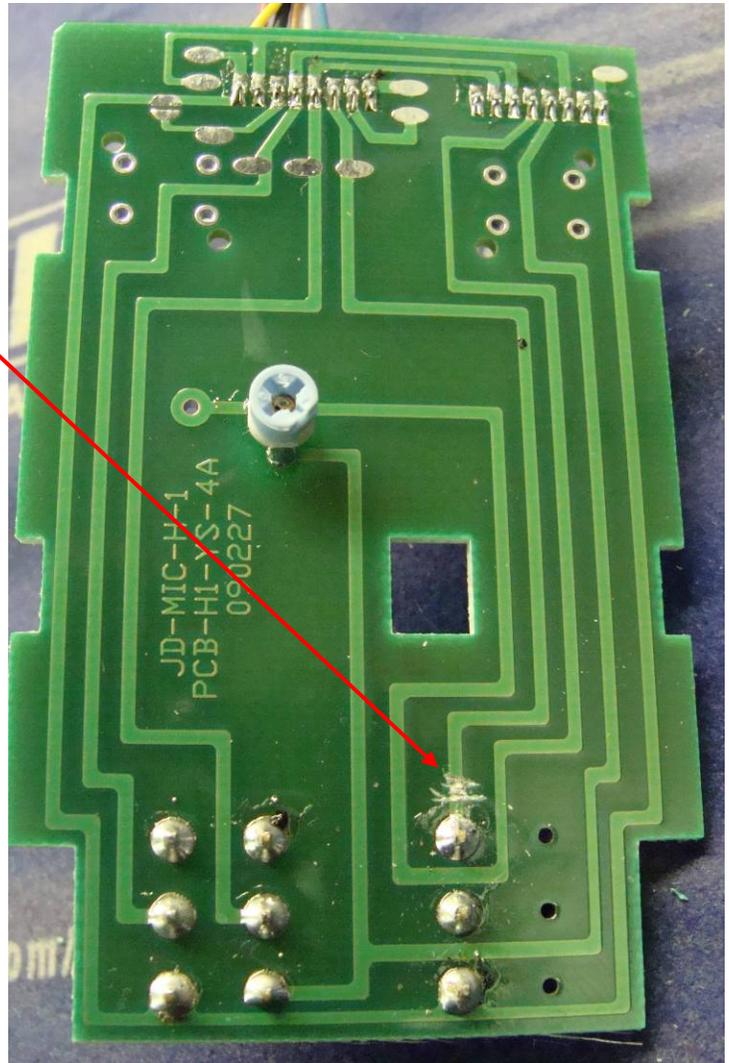

Step 7 Version 2

Add jumper wire between shown locations.

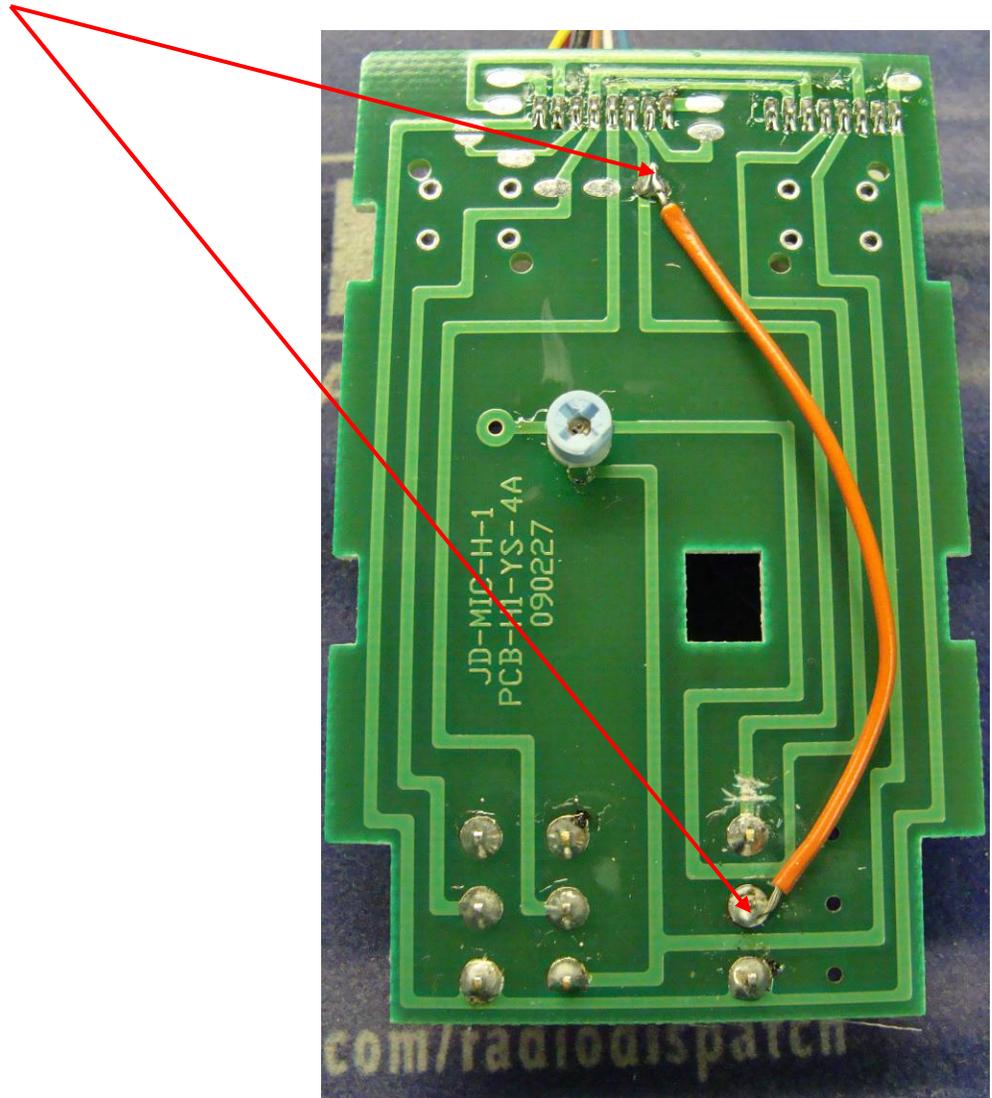

Step 8

Reassemble unit working backwards from step 5.

Revision History		
Document Title: MD-MS (DM-2000) Desk Top Microphone Monitor Rework Instructions		
Document Number: MN-DISPATCH-005		
Revision	Change Description	Date
A	Update brand, format and new document number.	15-FEB-2013

Suggestions or comments:

Contact technical support with suggestions or comments concerning this application note.

Technical Support:

Email: TelexDispatchtechsupport@us.bosch.com

Fax: 1-402-467-3279

Phone: 1-800-898-6723

Bosch Security Systems, Inc.
8601 East Cornhusker Highway
Lincoln Nebraska 68507

Phone: (800) 752-7560

Fax: (402) 467-3279

Email: Telexdispatch@us.bosch.com

Web: www.telex.com

Downloads: www.telex.com/Downloads/